Q-312





SVE BULLETIN

SPECIAL VEHICLE ENGINEERING - BODY BUILDERS ADVISORY SERVICE

E-Mail via Website: www.FordBBAS.com (click "Contact Us")

Toll-free: (877) 840-4338

QVM BULLETIN: Q-312 DATE: 28 / May / 2020

SEIC Customer Access Circuit Label Information Correction

REVISION	UPDATE	REVISION DATE
	INITIAL RELEASE	


Model(s) Affected:

2021MY Medium Duty F-650 / F-750 Gas and Diesel

Issue / Description:

On current production vehicles the Customer Access Circuit Label on the under-hood wiring harness is indicates incorrect circuit information. Below is a cross-reference chart to aid with identifying correct wire circuit color for wiring the SEIC controls.

This will remain the alternative solution until the label correction change can be put into production on or about July 2020 (Estimated, subject to change without notice).

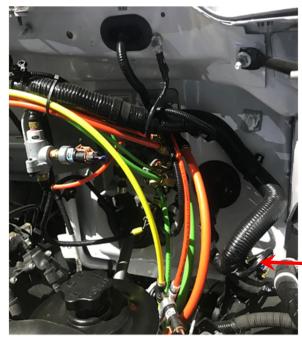

CROSS REFERENCE CHART

OHAITI			
	CURRENT LABEL	NEW LABEL	
CIRCUIT	(Incorrect)	(Correct)	
CE933 (Diesel)	BU-OG	BU-GN	
CE326 (Diesel)	BU-WH	BU-GY	
VMC05 (Diesel)	VT-OG	VT-WH	
LE424 (GAS)	YE-WH	YE-GN	

LABEL LOCATION

Refer to the Body Builder Layout Book for additional guidelines and recommendations. If you have any questions, please contact the Ford Body Builders Advisory Service as shown in the header of this bulletin.